




AW55-50SN

01-Up Volvo 40/50/60/Cross Country
Saturn Ion, Vue 02-03, Nissan Maxima
Saab 9.3, 9.5

AW55-50SN Front bell housing case bearing.

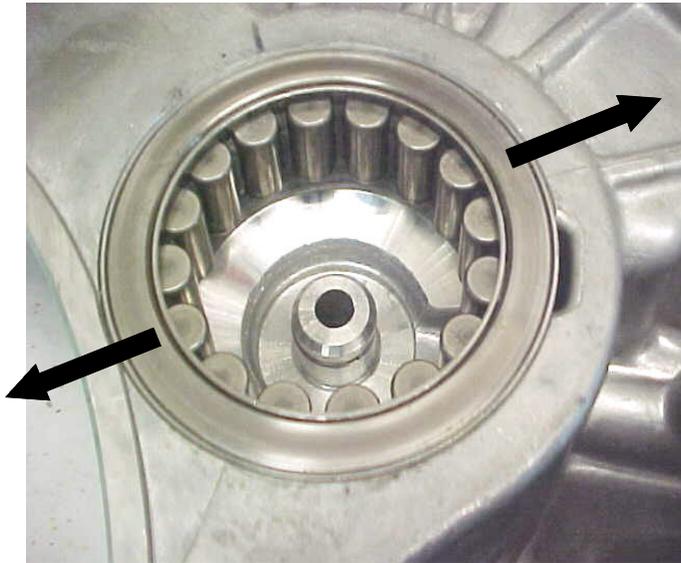

When rebuilding this unit, always check for play at this bearing. See directional arrows.

This case has been repaired using Omega machine's steel sleeve.

Case must be bored to accept sleeve, but stock bearing fit is restored.

Note that the bearing has no lettering on the side. This is due to the surface being used as a radial thrust face. Bearing must go in this way.

Also, note wear on center post. When the bearing walks the center post receives contact and wears on the side. A sealing ring is affected by this wear.

Omega Machine & Tool, Inc.
"Precision and Innovation for Today"

Tel. 916 372 6001 – Fax 916 372 6020
www.omegamachine.com