

## ISUZU

### Bushings

| PART NO      | DESCRIPTION AND SPECIFICATION   |
|--------------|---|
| ISUAXB       | '85-'91 ISUZU Impulse extension housing bushing A44DL Impulse and Pickups; '83-Up Toyota 4Spd, OD with L/U. |
| ISUAXB-AW372 | ISUZU AW-372 extension housing bushing: '88-Up Pickups and Sports Utility Vehicles. Yoke 1.50"              |
| ISUSXB #     | ISUZU extension housing bushing - '81 UP. RWD - 4Cyl., 5-Speed, No turbo.                                   |

### Hard Parts

| DESCRIPTION AND SPECIFICATIONS                                    |
|---|
| A40/A42D/A43D/A44DL forward clutch drum repair ring cut. R&R only |

## MAZDA

### Bushings

| PART NO   | DESCRIPTION AND SPECIFICATION   |
|-----------|---|
| A4LDLSB   | A4LD LATE FRONT STATOR bushing,'91-Up Aerostar Van 2/4WD, Wagon 2/4WD, Bronco 2/4WD, Ranger, Ranger II 4WD, Starlight van, European Granada & Sierra, Mustang & T-Bird, Explorer 2/4WD, Mazda Navajo 4WD w/4.0L.  |
| F4BK      | F4A-EL/F4-EAT 6-PIECE bushing KIT, '91-Up Ford Escort, Mercury Tracer; '90-Up Mazda 323 & Protégé. (2-4 Brake Drum, Rotor, Stator, Sun Gear with holes, Sun Gear without holes, Pump.)  |
| G4BD      | G4 BRAKE DRUM bushing - Non-Turbo Ford G4EAT, '89-Up Probe, Probe GT ; '91-Up Capri ; Non-turbo '86-Up Mazda G4A-EL 626; '87-Up MX6, 323.   |
| G4PSSB    | G4 Posi-Track Sun Shell TURBO BRAKE DRUM bushing (See G4BD above for applications.)   |
| G4BK      | G4A-EL/G4-EAT 7-PIECE bushing KIT, - '86-Up Mazda 626, '87-Up MX6, 323, '90-Up Protégé 4WD; '88-Up Probe, Probe GT; '91-Up Capri. (2-4 Brake Drum, Stator, Small & Large pump bushings, Rotor, Sun Gear with holes, Sun Gear without holes). Mazda may take G4PSSB Sun Shell bushing. |
| MAZSXB #  | MAZDA extension housing bushing – 85-90 B2200, 85-90 RX7  |
| M50DSXB # | FORD M50D extension housing bushing-'88-Up M5R1, 5-SPD, 2 WD; M5R2. 2nd exec. Cougar, T-Bird, Ranger, Aerostar, F-Series Trucks   |

### Sleeves

| PART NO. | DESCRIPTION AND SPECIFICATIONS  |
|----------|---|
| A4LDGBS  | A4LD governor bore sleeve– CHROME-MOLY - Fits American Eagle/Southeast Tool |

# Denotes a standard transmission or transfer case application

## Hard Parts

### DESCRIPTION AND SPECIFICATIONS

A44DE forward clutch drum repair ring cut. R&R only Miata 98-99



R4A-EL governor bore repair.

## Mercedes

### Bushings

| PART NO | DESCRIPTION AND SPECIFICATION  |
|---------|--|
| 15D15   | MERCEDES 722.3 FRONT pump body bushing(HUB OF 1.692) 1981-Up. Steel-backed Babbitt (6-bolt pan, 4-speed) |

## Hard Parts


### DESCRIPTION AND SPECIFICATIONS

Mercedes Bell Housing - Replaced stator

RE-bush and seal ZF pump body

Repair Mercedes case governor bore

### Omega number MERBH

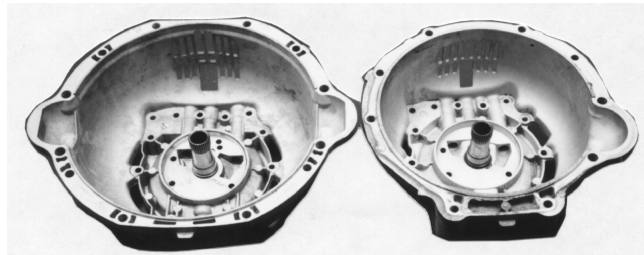

Mercedes Benz Bell Housings – Fitted with new hardened stator shaft

18.